


Precautions when installing the product in NB6C/NB8C

*Note: A clearance between the upper control arm and the suspension may be close depending on the upper control arm shape when installing the product in NB6C/NB8C.

Concerned upper control arm shape is as seen in Fig. 1.


Specifically, the black shaded section (reinforced part of the arm) may interfere with the suspension.

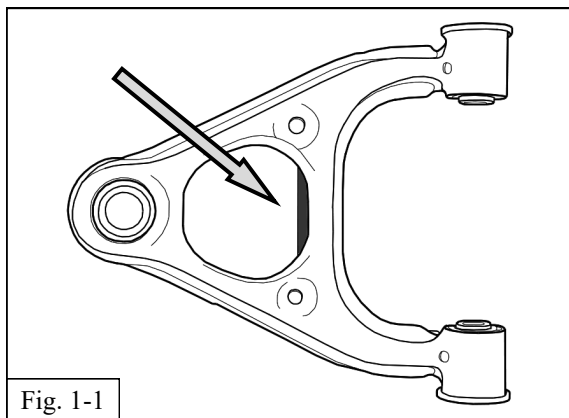

◆Applicable models

- NB6C - 105988 ~
- NB8C - 110351 ~

Vehicles noted above or vehicles that had replaced the upper control arm by maintenance or repairs.

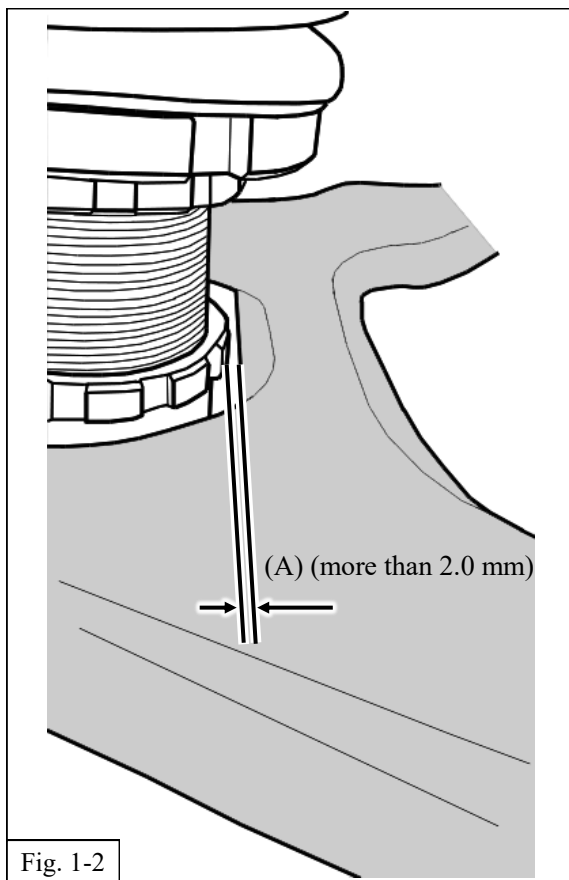

Check the clearance (A) of between the upper control arm and the suspension should be more than 2.0 mm at a 0 gravity state (Vehicle was jacked up) when installing the product.

(Fig. 1-2)

Adjust the camber angle to keep the clearance (A) becomes more than 2.0 mm if the clearance is less than 2.0 mm.